### Autonics

Digital Pressure Sensor (fluid type)

# **PSAN Series**

## INSTRUCTION MANUAL







Thank you very much for selecting Autonics products. For your safety, please read the following before using.

### Safety Considerations

M 🔛 🙈

 ※Please observe the cautions that follow;
 ▲ Warning Serious injury may result if instructions are not followed.
 ▲ Caution Product may be damaged, or injury may result if instructions are not follow  ${\it X}$  The following is an explanation of the symbols used in the operation manual.  $\Delta$  Caution: Injury or danger may occur under special conditions.

- I. Fail-safe device must be installed when using the unit with machinery that may cause serious injury or substantial economic loss. (e.g. nuclear power control, medical equipment, ships, vehicles, railways, aircraft, combustion apparatus, safety equipment, crime/disaster preventior devices, etc.)

  Failure to follow this instruction may result in fire, personal injury, or economic loss.

  Install on a device panel or to a pressure port directrly to use.

  Failure to follow this instruction may result in fire.

  3. Do not connect, repair, or inspect the unit while connected to a power source.

  Failure to follow this instruction may result in fire.


  4. Check \*Connections\* before wiring.

  Failure to follow this instruction may result in fire.

  5. Do not disassemble or modify the unit.

  Failure to follow this instruction may result in fire.

### **⚠** Caution

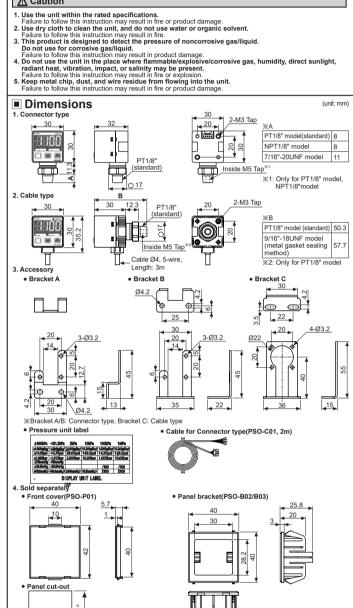

### 36 +0.5 Functions

Pressure unit change
PSAN-LV01C(P) and PSAN-LC01C(P) has 7 kinds of pressure unit, PSAN-L01C(P) and PSAN-L1C(P) has 5
kinds of pressure unit. Please select the proper unit for application.

+PSAN-LV01C(P), PSAN-LC01C(P): kPa, kgt/cm², bar, psi, mmHg, inHg, mmH₂,0

+PSAN-L01C(P), PSAN-L1C(P): MPa, kPa, kgt/cm², bar, psi

\*\*When using mmH₂,0 unit, please multiply display value by 100.

%PSO-B02(white): Connector type

PSO-B03(black): Cable type

(panel thickness: 0.8 to 3.5mm)

- Non-using mmH<sub>2</sub>O unit, please multiply display value by 100.

   When using mmH<sub>2</sub>O unit, please multiply display value by 100.

   Output mode change
   There are 5 kinds of control output mode in order to realize the various pressure detection.

   Hysteresis mode [H95.5]: When needed to change hysteresis for detecting pressure.

   Window comparison output mode [H95.6]: When needed to detect pressure in certain area.

   Hysteresis Window comparison output mode [H95.9]: When both hysteresis mode and window comparison output mode are required.

   The state of the s
- א האטרים וויינים פור ופקטוופט. Automatic sensitivity setting mode [אולנים]: When needed to set detection sensitivity automatically at proper position Forced output control mode [אולנים]: When needed to display pressure with remaining comparison output OFF regardless of set value.

  Control output change
- Control output change
  Type of control output for OUT1 and OUT2 can be able to set Normally Open and Normally Closed.

  W Note that Normally Open and Normally Closed.

- Type of control output for OUT1 and OUT2 can be able to set Normally Open and Normally Closed.

  ※ Note that Normally Open and Normally Closed provide opposite output.

  Response time change(Chattering prevention)
  It can prevent chattering of control output by changing response time.
  It is able to set 5 kinds of response time(2.5ms, 5ms, 100ms, 500ms, 1000ms) and if the response time is getting longer, the detection will be more stable by increasing the number of digital filter.

  Analog output scale setting and Hold/Auto Shift setting

  Analog voltage output scale setting: The scale function for analog output voltage (1-5vDC) is not fixed to the rated pressure range. It can be changed for User's application. Analog output is 1-5vDC within the pressure range from the pressure point [R 1 √ ] for TVDC to the pressure point [R 5 √ ] for 5vDC.

  Analog current output scale setting: The scale for analog output Current (DC4-20mA) is not fixed to the rated pressure range. It can be changed for User's application. Analog output is 4-20mA within the pressure range from the pressure point [R 2 √ ] for TwA to the pressure point [R 2 √ ] for TwA to the pressure point [R 2 √ ] for TwA to the pressure point [R 2 √ ] for TwA to the pressure point [R 2 √ ] for TwA to the pressure point [R 2 √ ] for TwA to the pressure point [R 2 √ ] for TwA to the pressure point [R 2 √ ] for TwA to the pressure point [R 2 √ ] for TwA to the pressure point [R 2 √ ] for TwA to the pressure point [R 2 √ ] for TwA to the pressure point [R 2 √ ] for TwA to the pressure point [R 2 √ ] for TwA to the pressure point [R 2 √ ] for TwA to the pressure point [R 2 √ ] for TwA to the pressure point [R 2 √ ] for TwA to the pressure point [R 2 √ ] for TwA to the pressure point [R 2 √ ] for TwA to the pressure point [R 2 √ ] for TwA to the pressure point [R 2 √ ] for TwA to the pressure point [R 2 √ ] for TwA to the pressure point [R 2 √ ] for TwA to the pressure point [R 2 √ ] for TwA to the pressure point [R 2

- The key lock function prevents key operations so that conditions set in each mode. [preset/parameter mod not inadvertently changed. There are 2 kinds of key lock functions available.

  1. o [ 1: All keys are locked; therefore it is not available to change parameter settings, preset value, zero adjustment, High/Low peak check and [54] n] data initialization. (Lock setting change is available)

  1. o [2: Partially locked status; therefore it is not available to change parameter settings only(Lock setting change is available). Other settings are still available.

  1. o [5: All of the setting is available, all keys are unlocked.

  2. Zero point adjustment.

- ② Zero point adjustment
  The zero point adjustment function forcibly sets the pressure value to "Zero" when the pressure port is opened
  to atmospheric pressure. When the zero adjustment is applied, analog output [Voltage or Current] is changed
  by this function.(Press ☑ + ᢙ keys over 1 sec. in RUN mode.)
  ⑤ High Peak / Low Peak Hold
- High Peak / Low Peak Hold
  This function is to diagnosis malfunction of the system caused by parasitic pressure or to check through memorizing the max./min. pressure occurred from the system.

Display	Description	Troubleshooting
Errl	When external pressure is input while adjusting zero point.	Try again after removing external pressure
Err2	When overload is applied on control output	Remove overload.
Err3	When setting condition is not met in Auto sensitivity setting mode.	Check setting conditions and set proper set values.
LLLL	When applied pressure exceeds Low-limit of display pressure range.	Apply pressure within display pressure
нннн	When applied pressure exceeds High-limit of display pressure range.	range.
-HHLLHL-	Auto shift correction error.	Set the corrected set value within setting

\*The above specifications are subject to change and some models may be discontinued without notic \*Be sure to follow cautions written in the instruction manual and the technical descriptions (catalog, homepage).

Specifications



Unit Descriptions



Connector type: Approx. 173g (approx. 88g), Cable type: Approx. 167g (approx. 90g)

hysteresis by pressure unit calculation error.


\*\*For using mmH<sub>2</sub>O unit, multiply display value by 100. Environment resistance is rated

# Output Operation Mode

the proper output operation mode by the detection.

Window comparison output mode[½! \(\alpha\)]

Olt is able to set the range for high[n! \(\beta\), n! \(\beta\)] prosessure detection level whe it is required to detect pressure at a certain range.

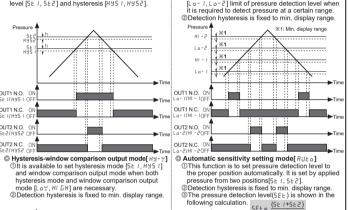

 $5Et = \frac{(5t \ 1+5t \ 2)}{2}$ ні Бн 5±2 Lo! SEE SŁ OUT1 N.C. ( OUT2 N.O OUT2 N.C.

or Nil bit of FF

■ Forced output control mode[Fout]

• Used to display pressure with forcibly holding.

• In parameter setting, if output operation mode y holding comparing output OFF regardless of set value. ion mode setting [ⴰⵍⵍⴰʔ] is changed to [۴.ⴰⵍⵍⴰ], forced output control

© in parameter setting, in output control mode is operated.

③ OUT1, 2 can be ON/OFF manually by pressing ⊚, ⊗ key While the forced output control mode is applied.

RUN mode

Forced output control mode


RUN mode

RUN mode Forced output control mode operation status RUN mode OUT1 OFF Flashing B3.1

## Control Output and Connection Diagram

 ○ Analog output type (voltage output PSAN-L/B□

 • NPN open collector output

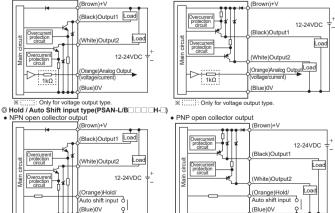


(Blue)0V

Pressure port is divided as basic and option specification. Therefore, be sure that to use commercially available one touch fitting,(Standard: R(PT)1/8", Option: NPT1/8", 9/16"-18UNF, 7/16" - 20 UNF) Please connect it by using spanner(17mm) at the metal part in order not to overload on the body when connecting one touch fitting.


Installation


- touch fitting.
  PSAN Series provides 2 brackets for connector type, 1
  bracket for cable type. The 2 types of installation is available
  by for installation environments.
  Af first, please unscrew hexagon wrench bolt and assemble
  the bracket on this unit by fixing hexagon the wrench bolt.
  In this case, tightening torque of hexagon wrench should
  be max. 3N-m. It may cause mechanical problems.





. Panel bracket(PSO-B02/B03) and front Please see the figure for installation.








Setting

Press M ke

ss M key

Press M key Parameter setting

- will flash twice, then returned to RUN mode.

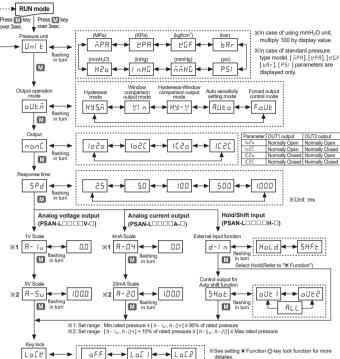


💥 If there is no additional key operation within 60 sec. while setting, current set value is not valid and previous set value will be remained

### Preset Setting


flashing in turn

- ※ [ run] flashes twice when returning to RUN mode
- ※ Press ♥, ♠ key to change set values.
  ※ Press M key to save set value in each parameter and move to next parameters.

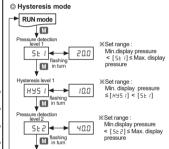


flashing in turn Window comparison output mode

H952 ◀

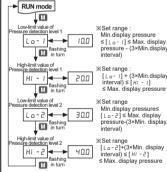

O Hysteresis-Window comparison output mode ► RUN mode

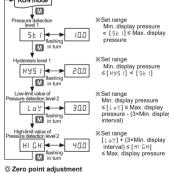

© Zero point adjustment

1. Please press ☑ + ☒ keys for over 1sec. same time putting an applied pressure in atmospheric pressure.

 When the zero point adjustment is completed, it will display 0.0 and return to RUN mode automatically. uispiay but and return to Kort mode automaciany. «If executing zero point adjustment on external pressure being at pressure port [£rr |] flashes 5 times. Please execute it in the atmospheric pressure after removing external pressure. \*\*Please execute zero point adjustment regularly.

# O Automatic sensitivity setting mode RUN mode

flashing in turn

flashing in turn ※[5±1]+1% of rated pressure≤[5±2]≤ Max. display pressure 2 0.0 5£2 < flashing M in turn 


※ [ E ← ∈ ∃] Error flashes 3 times in case setting conditions are not met, resetting is on standby is no additional key operation within 60 sec. while it is returned to Run mode (Except for force output

setting, it is returned to Run mode (Except for force output mode). Previous set values are remained. (In case of changing output operation mode, no preset values will be initialized. Instead, previous output operation

values will be initialized. Instead, previous output operation settings will become the preset values. 
KWhen changing pressure display unit, resolution and Hold/ Auto Shift input function, preset values will be initialized as shown the table below. (When changing pressure display unit, preset value will be automatically switched to changed pressure unit.)

Output mode	Negative pressure 0.0 to -101.3	Standard pressure 0.0 to 100.0	Standard pressure 0 to 1.000	Compound pressure -101.3 to 100.0
нч5л	5£ 1:-50.0 H35 1:0.0 5£2:-50.0	SE 1:50.0 HYS 1:0.0 SE2:50.0 HYS2:0.0	SES:200 HA2 1:0 SES:200	5± 1:50.0 H35 1:-50.0 S±2:50.0 H352:-50.0
91 n	Lo-1:0.0	Lo-1:0.0	Lo- 1:0	Lo-1:-50.0
	HI - 1:-50.0	HI - 1:50.0	HI - 1:500	HI - 1:50.0
	Lo-2:0.0	Lo-2:0.0	Lo-2:0	Lo-2:-50.0
	HI - 2:-50.0	HI -2:50.0	HI -2:500	HI -2:50.0
HA- 5	5t 1:-50.0	SE 1:50.0	SE 1:500	5E 1:50.0
	H95 1:0.0	H95 1:0.0	H95 1:0	H95 1:-50.0
	Log:0.0	Lag:0.0	Log:500	Leg:-50.0
	HI GH:-50.0	HI GH:50.0	HIGH:0	HI GH:50.0
AULo	5£ 1:0.0	5£ 1:0.0	5± 1:0	5t 1:-50.0
	5£2:-50.0	5£2:50.0	5±2:500	5t2:50.0
	5££:-25.0	5££:25.0	5E±:250	5tt:0.0

function is not available to use in Hold/Auto shift n

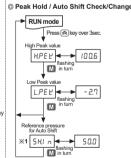

★1: PSAN-L □ □ □ H - □ Displayed only when [d-l n] is set to [5HFt]. Auto shift reference pressure can is set to [ 3 nr c ]. Auto still reterence pressure can be set within display error range.(Low\_Range ≤ [ 5 H/ n] ≤ High\_Range) • Low\_Range = Min.display pressure - Min. preset se

value
• High\_Range = Max.display pressure - Max. preset set value

set value

#If pressing 
#If p

## Cautions during Use

- 1. Follow instructions in 'Cautions during Use'
- Otherwise, It may cause unexpected accidents 2. 12-24VDC power supply should be insulated and limited voltage/current or Class 2, SELV power
- supply device.
- 3. Use the product, 3 sec after supplying power. 4. When using switching mode power supply, frame ground (F.G.) terminal of power supply should be
- grounded.

  5. Wire as short as possible and keep away from high voltage lines or power lines, to prevent inductive
- 6. This unit may be used in the following environments ①Indoors (in the environment condition rated in 'Specifications') @Altitude max. 2.000m

Buzzers upplies ber, CO<sub>2</sub>, Nd:YAG)

# Major products

■ E-mail: sales@autonics.

http://www.autonics.com TEL: 82-51-519-3232

Autonics Corporation

DRW171186AA